

- **ENGINE—7.3L DIT—MANUAL TRANSMISSION—OIL LEAK—TRANSMISSION COVER PLATE RUBS ON ENGINE OIL PAN**

**Article No.
95-14-12**

- **ENGINE OIL LEAK—7.3L DIT—MANUAL TRANSMISSION—TRANSMISSION COVER PLATE RUBS ON ENGINE OIL PAN**

FORD: 1994-1995 F SUPER DUTY, F-250, F-350

ISSUE

The rear of the engine oil pan, near the crankshaft, may leak oil. This can be caused by the clutch dust cover plate, on the bottom of the manual transmission, coming in contact with the engine oil pan and rubbing a hole through the pan.

ACTION

Install a new clutch dust cover plate and replace the oil pan. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

1. Remove the Clutch Dust Cover Plate, referring to the appropriate year F-Series Service Manual, Section 08-01.
2. Inspect the rear of the oil pan near the crankshaft, looking for wear marks on the pan.
3. If the wear mark(s) on the oil pan has evidence of oil leaks (crack or hole), replace the Engine Oil Pan Assembly (F4TZ-6675-A). Refer to the appropriate year 7.3L Turbo Diesel Service Manual Supplement, Section 03-01D, for service procedures. If the wear mark on the oil pan has no evidence of oil leaking, continue with diagnosis of customer concern over oil leaking. Proceed to Step 4.

4. Install the redesigned Clutch Dust Cover Plate (F5TZ-7007-AD) and visually check to see that the edge of the plate is not rubbing the oil pan.

PART NUMBER	PART NAME
F5TZ-7007-AD	Clutch Dust Cover Plate
F4TZ-6675-A	Engine Oil Pan Assembly

OTHER APPLICABLE ARTICLES: NONE

WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
951412A	Replace Clutch Dust Cover Plate Only	0.3 Hr.
951412B	Replace Engine Oil Pan (Includes Clutch Dust Cover Replacement)	10.2 Hrs.

DEALER CODING

BASIC PART NO.
7007

OASIS CODES: 401000, 505000

CONDITION
CODE
11